

## Notes

- 1. Leak Tested To 5x10E-10 standard cc/se of He.
- Dimensions Symmetrical About Centerlines.
  This is a vacuum safety 'over pressurization prevention' device. As such, ruptured discs can not be repaired, and must be replaced with a completely new unit.
- 4. Be Careful Of Burst Disc Foil, It Is Very Fragile

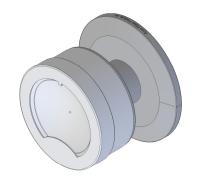

Rev.	Description	Date	Made By	Approval
Α	Initial Release	3/25/2009	CR	СМ
В	Changed Burst Disc And Adapter To New Version	7/1/2020	Farrell	

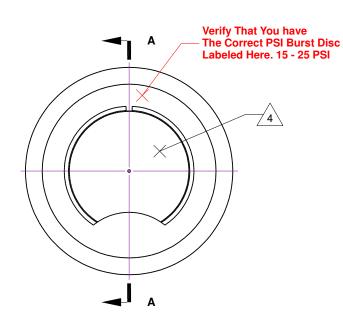

1.61 .20 Ø.63 Ø1.81 Ø.75 Non-Rotatable

Flange, NW40 KF with Thru Holes. Stainless Steel, 304

Section A-A

Accu-Glass Products Inc. 25047 Anza Drive Valencia, CA 91355 T 818-365-4215 F 818-365-7074 www.accuglassproducts.com

## **UNCONTROLLED WEB DRAWING**

Proprietary and Confidential The information contained in this drawing is the sole property of Accu-Glass, Products Inc. Any reproduction, in part or as whole, without the written permission of Accu-Glass Products, Inc., is strictly prohibited.

Material						
Stainless Steel						
Tolerances, unless otherwise specifie						
.X ± . 030 .XX ± .010 .XXX + .005	Angles $\pm$ 0.5° Finish 63Ra					
	1					

Ø2.16

	Title			PBD-K40			
	Drawn by Date	CR 3/25/2009	No.	112073		Re	v. <b>B</b>
	Approved	СМ			She	et	1 OF 1
_	Approved				1		. 0